


ND NORSK DATA	ENGINEERING CHANGE ORDER		PAGE 1 OF 4.
			ECO NO.: 100-782
VALID FOR.	PART NOS. : 324909 VERSIONS : AA NAME : MAXSON DISKBOARD PRINT NOS.: 5909 ND NOS. : --		
NEW VERSION	PART NOS. : 324909 VERSIONS : BA NAME : MAXSON DISKBOARD		
SYMPTOMS	<u>FATAL:</u>  Overwriting on SCSI-devices or transfer error.		
COMPO- NENTS  Resistor	REMOVE:	INSERT:  2 pc. 330 ohm (p/n 503020)	
VALIDITY	X      EQUIPMENT IN PRODUCTION  X      FUTURE PRODUCTION  * *    FIELD ACTION		
RESPONS- IBILITY	APPROVED BY: LB _____ DATE:            910620 _____	REVISION:            _____ ISSUED BY:            _____ DATE:                _____ _____	


- ND ServiceTeam -

ND NORSK DATA	ENGINEERING CHANGE ORDER	PAGE 2 OF 4.
PART NO.: 324909 AA > BA		ECO NO.: 100-782
ISSUED	DATE: 910612	BY (INITIALS): AMA

Insert 1 pc. 330 ohm resistor C3/38 - C3/26 (REQ-0 - TERMPWR)  
 Insert 1 pc. 330 ohm resistor C3/48 - C3/26 (ACK-0 - TERMPWR)

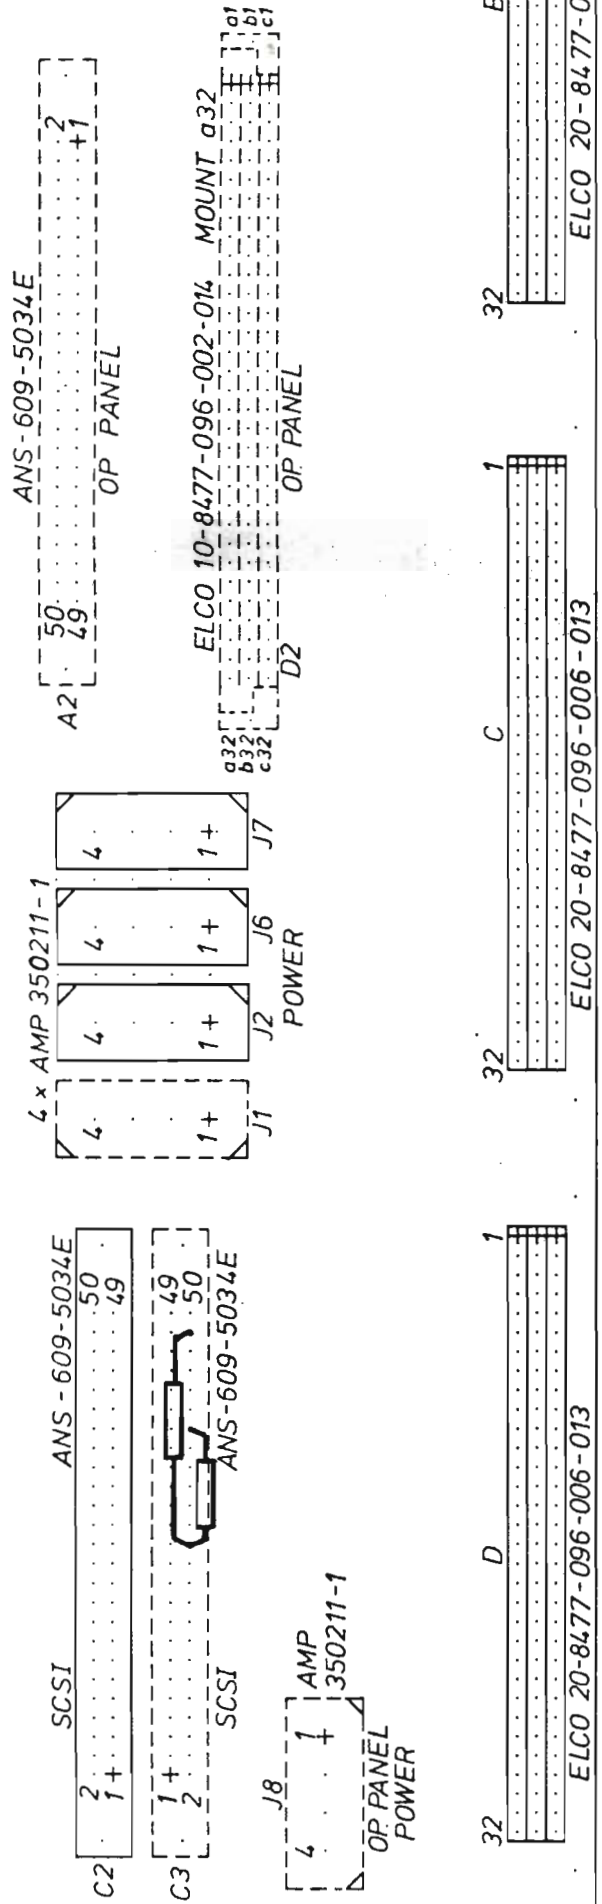

Components A2,C3,D2,J1,J3 and J8 are to be mounted on solder side.

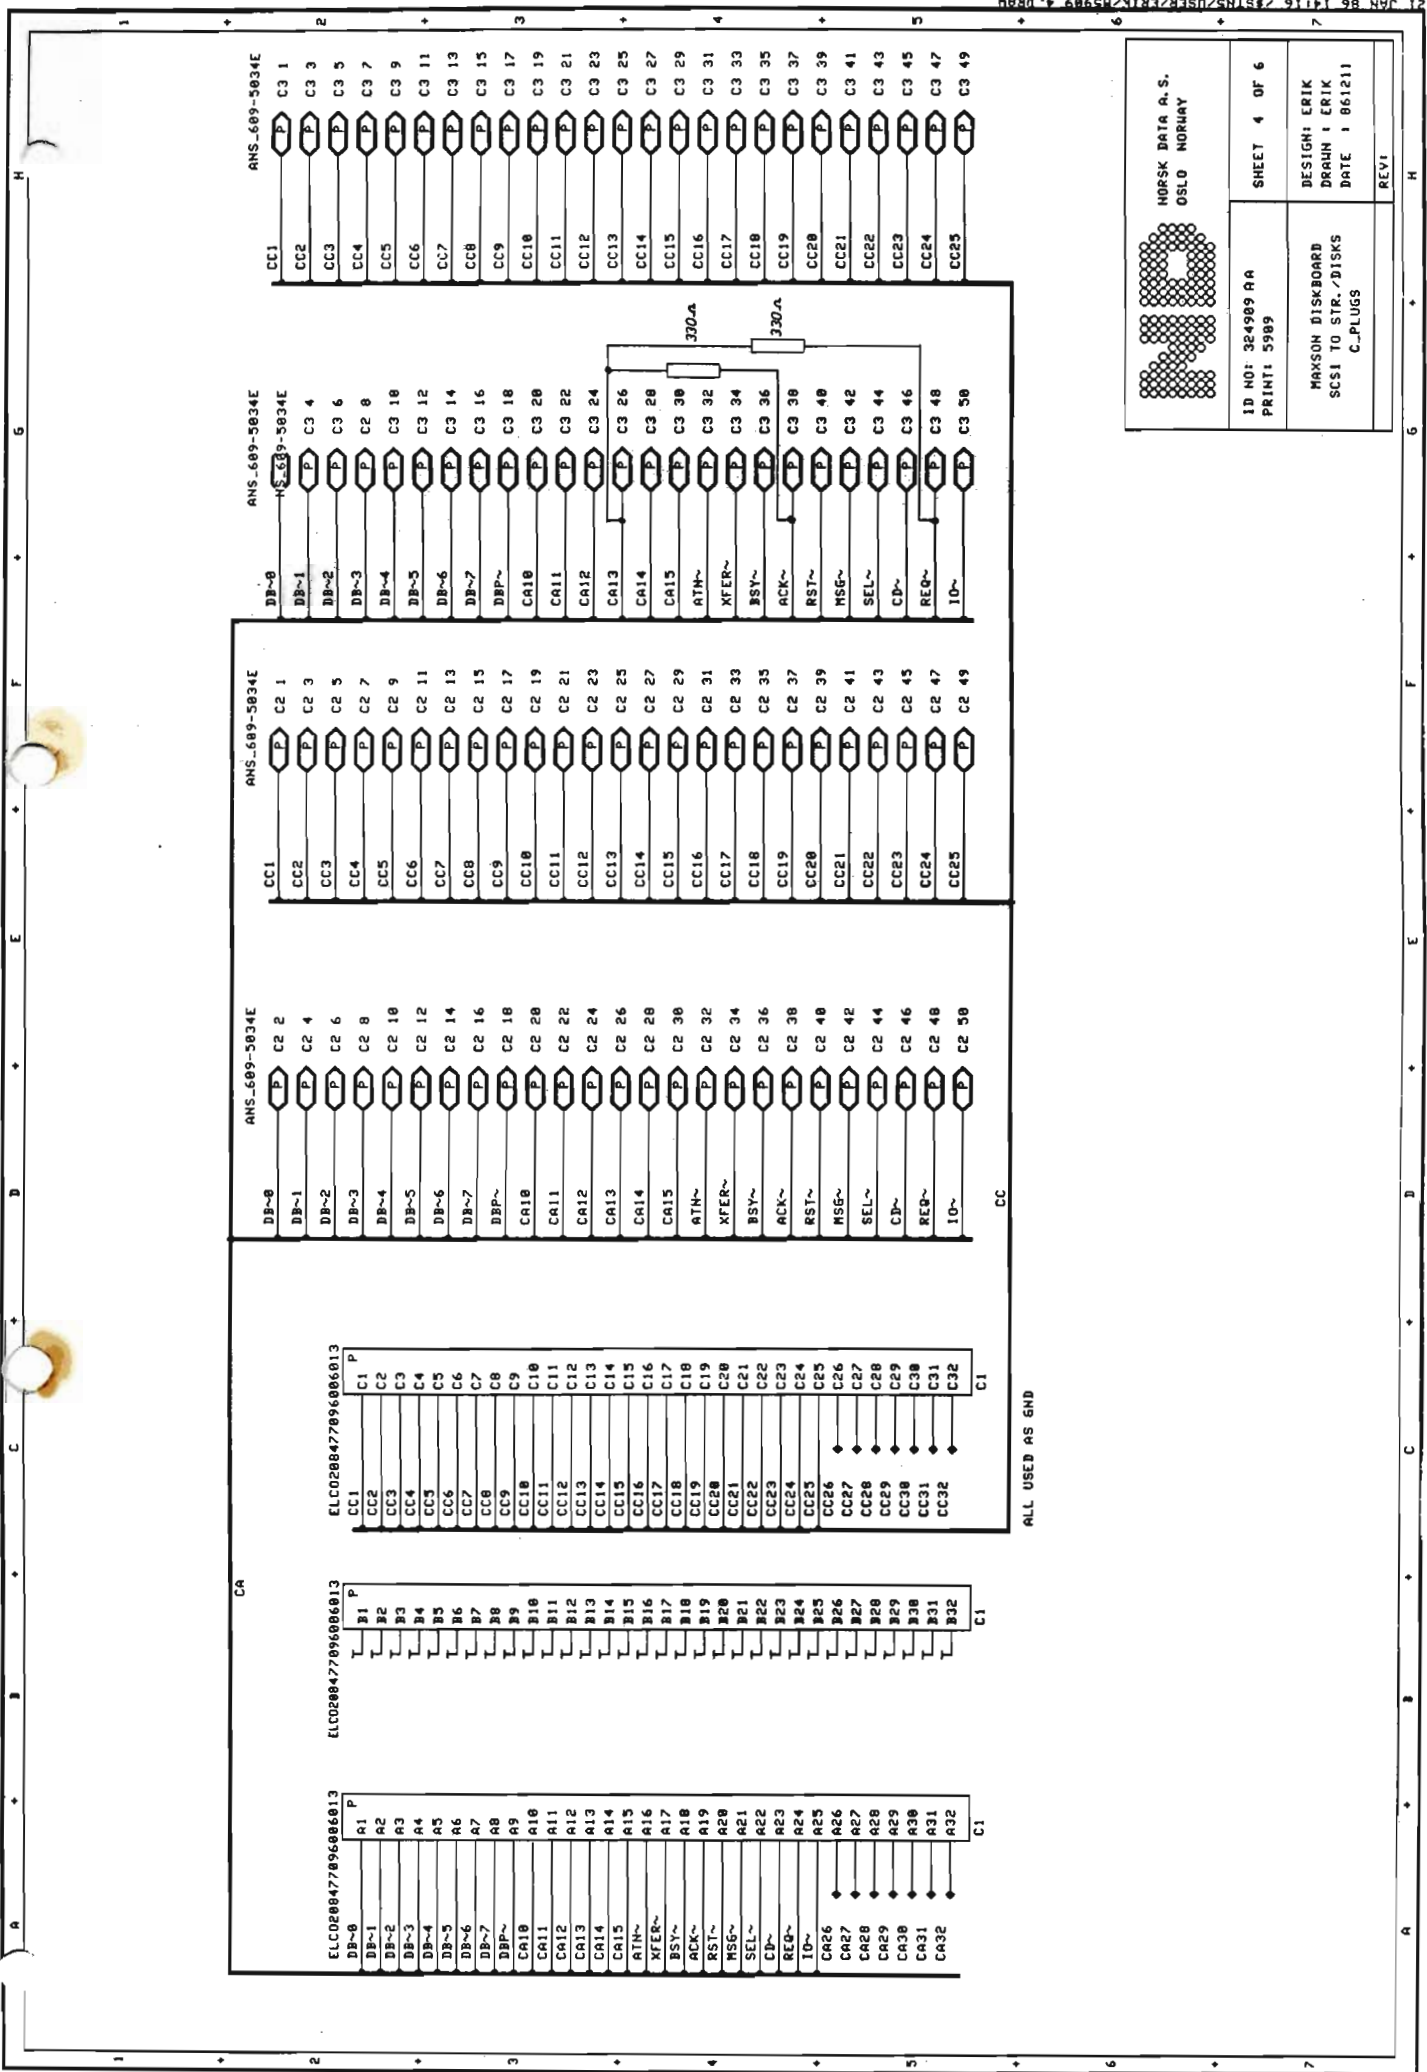

ALL USED AS GND

MORSK DATA P.A.S.  
OSLO NORWAY

ID NO: 324989 AA PRINT: 5989	SHEET 4 OF 6
MAXSON DISKBOARD SCSI TO STR./DISKS C_PLUGS	DESIGN: ERIK DRAWN: ERIK DATE: 1 861211
REVI:	